

Cranks over but has a hard start or no start


2003-2004 Ford Excursion, F-Super Duty Equipped with 6.0L and 7.3L Diesel

Symptom:

Some vehicles equipped with a 6.0L and 7.3L diesel may have this condition. This may be due to a Glow Plug Control Module **CONNECTOR**.

Procedure:

1. Make sure battery or batteries are fully charged
2. Inspect GPCM connector for:
 - Pin fit. No looseness
 - Pin pulled out
 - Bent pins
 - Corrosion / oxidation
3. If connector problems exist, replace connector with service kit from dealer. (GPCM Connector Kit: 4C32-12B568-AA)
4. If no connector problems present, proceed with normal diagnosis.

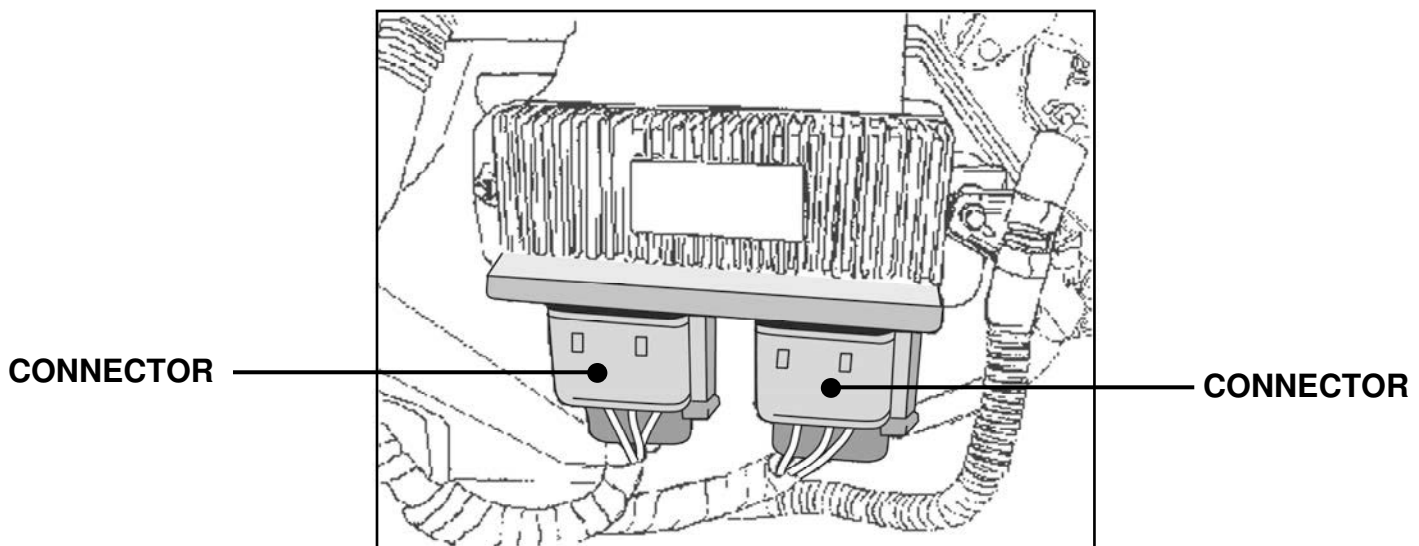

Glow Plug Control Module located right front engine