


# *Duralast* Bearing Facts

## 2005-1999 FORD F250, F350, F450 & F550, 4X4 Models

Front Wheel Hub Numbers:

DL515021, DL515025, DL515026, DL515027, DL515056,  
DL515075, DL515076, DL515077

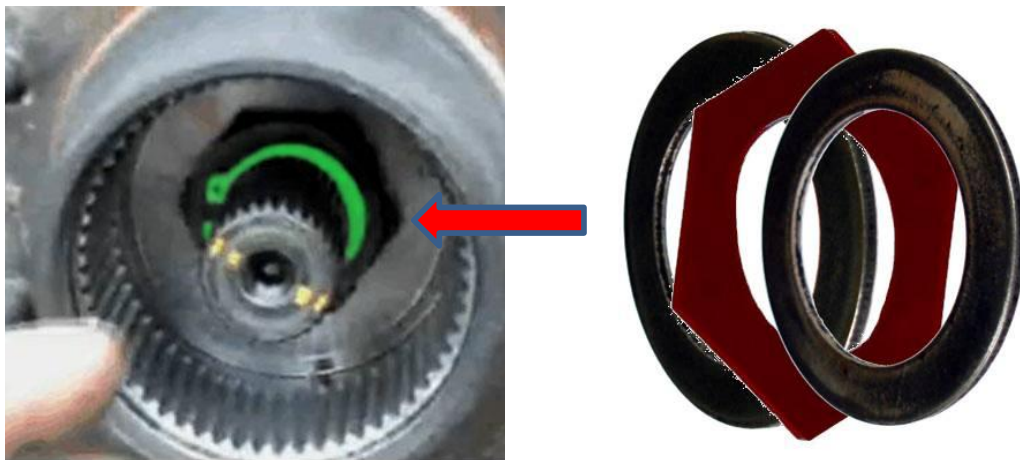

Assembling thrust washers incorrectly, may cause the non-metallic washer to fail prematurely, allowing the axle shaft lateral movement under torque, causing damage to the wheel hub and bearing.

Correct location of the non-metallic washer is centered between the two metallic washers.

Ensure the cir-clip is fully seated before inserting the actuator.